

# 2015 Volvo L90G

Serial #: VCE0L90GK0S617624

Romco Equipment Co  
Carrollton, TX  
817-626-2288

- Air conditioning
- Directional lights
- Quick Coupler
- SMU/Hours: 3048
- Overall: Fair
- Joystick control
- External rearview mirrors
- Ride control system
- Start Run: Yes
- Insp Date: 11/20/2017



2015 Volvo L90G

(Continued)

Serial #: VCE0L90GK0S617624

## General Appearance

GENERAL:			
Radiator Grille:	Good	Fuel Tank:	Good
Radiator Shroud:	Good	Cab Doors:	Good
Engine Enclosure:	Good	Bumper:	Good
Hood:	Good	Differential supports:	Good
Stack:	Good	Counterweight:	Good
Right front fender:	Good	Cab:	Good
Left front fender:	Good	Steps:	Fair
Right rear fender:	Good	Grab Irons/Handrails:	Good
Left rear fender:	Good	Paint:	Fair
Main Frame:	Good	Oil Sample Taken:	No
Precleaner bowl:	Good		
NOTES:			
.			

2015 Volvo L90G

(Continued)

Serial #: VCE0L90GK0S617624

## Interior Section

SAFETY ITEMS:			
Glass:	Good	Neutral Start Switch:	Not Available
Mirrors:	Good	Fire Suppression System:	Not Available
Seat Belt:	Good	Horn:	Not Available
Back Up Alarm:	Good	Roll Over Protection:	Non-Rops
Fan Guards:	Good		
NOTES:			
OPERATOR AREA:			
Dash Console:	Good	Seat Cushion:	Good
Meter:	Good	Arm Rests:	Good
Gauges:	Good	Floor Boards/Mats:	Good
Control Pattern Decals:	Good	EMS Panel:	Good
Switches:	Good	Warnings:	Good
Windshield Wipers:	Poor	Door Latches:	Good
Heater:	Good	Current Parts Manual:	No
A/C:	Poor	Current Safety Manual:	No
Interior Lights:	Good	Current O&M Manual:	Yes
NOTES:			

2015 Volvo L90G

(Continued)

Serial #: VCE0L90GK0S617624

## Power Systems

ENGINE:			
Engine Make Model:	Volvo D6H	Oil Pressure:	Normal
Engine S/N:	11668358	Smoke:	No
+ Engine Hours:	3048	Smoke Color:	Not Applicable
Mechanical: 5188		TurboCharger:	Good
Oil Leaks:	Yes	Fuel Injection System:	Good
Blow-by:	No	Governor:	Good
Knocking:	No	Engine Supports:	Good
Compression in Radiator:	No	Air Cleaners:	Good
Water in Oil:	No	Last Scheduled Oil Sample:	N/A
Fluid Level OK?:	Yes	Last Preventive Maintenance:	N/A
Anit-Freeze Color:	Red		
NOTES:			
COOLING SYSTEM:			
Radiator:	Good	Fan:	Good
Coolers:	Good	Fan Drive:	Good
Hoses:	Good	Belts:	Good
Water Pump:	Good	Pulleys:	Good
NOTES:			
ELECTRICAL SYSTEM:			
Batteries:	Good	Wiring:	Good
Battery Cables:	Good	Pre-Heater:	Good
Starter:	Good	Lighting:	Fair
Alternator:	Good		
NOTES:			

2015 Volvo L90G

(Continued)

Serial #: VCE0L90GK0S617624

## Power Systems - Continued

TRANSMISSION:			
Serial #:	N/A	Controls:	Good
Type:	APS	Seals:	Good
Speeds:	Excellent	Torque Converter:	Good
Transmission Forward:	Good	Temp/Pressure Gauges:	Good
Transmission Reverse:	Good	Is the Transmission Noisy?:	No
Case:	Good		
NOTES:			
STEERING:			
Front axle:	Not Available	Articulation P & B:	Good
Steering Linkage:	Good	Steering cylinder:	Good
Steering V alve:	Good	Tie rods/ rod ends:	Not Available
Steering Pump:	Good		
NOTES:			
BRAKE:			
Mechanism:	Wet	Lines:	Good
Brake Type:	Pedal	Compressor:	Not Available
Performance:	Good	Brake linkage:	Good
Brake drums:	Not Available	Master cylinder:	Good
Rotors:	Good	Parking brake:	Good
Control V alve:	Good		
NOTES:			
FINAL DRIVE:			
Front Planataries:	Good	Rear Wheel lugs & rims:	Good
Front Differential:	Good	Front Axle bolts:	Good
Rear Planataries:	Good	Rear Axle bolts:	Good
Rear Differential:	Good	Front axle housings:	Good
Front Wheel lugs & rims:	Good	Rear axle housings:	Good
NOTES:			

2015 Volvo L90G

(Continued)

Serial #: VCE0L90GK0S617624

## Hydraulics

HYDRAULICS:			
Right lift cylinder:	Good	Pumps:	Good
Left lift cylinder:	Good	Valves:	Good
Bucket cylinder:	Good	Control linkage:	Good
Hose lines:	Good	Bucket & hoist kickout:	Good
NOTES:			

2015 Volvo L90G

(Continued)

Serial #: VCE0L90GK0S617624

## Front Bucket

FRONT BUCKET:			
Bucket T ype:	General Purpose	Bucket adapters:	Not Available
Width:	102 Inches	Bucket teeth:	Not Available
Capacity:	N/A	Arms & cranks:	Good
Bucket bottom:	Good	Loader frame:	Good
Bucket sides:	Good	Loader P & B:	Good
Bucket linkage:	Good	Quick coupler:	Good
Bucket mounts:	Good		
NOTES:			

2015 Volvo L90G

(Continued)

Serial #: VCE0L90GK0S617624

### Tires

TIRES:					
Front Tire Size:	Left: 20.5R25-50%	Right: 20.5R25-47%	Rear Tire Size:	Left: 20.5R25-38%	Right: 20.5R25-45%
Front Tire Brand:	Left: Bridgestone	Right: Bridgestone	Rear Tire Brand:	Left: Bridgestone	Right: Bridgestone
Front Tire Measurement:	Left: 21/32	Right: 20/32	Rear Tire Measurement:	Left: 16/32	Right: 19/32
NOTES:					



2015 Volvo L90G

(Continued)

Serial #: VCE0L90GK0S617624

## Comments

COMMENTS:
Creditor Comments: Has Rear View Camera
Public Comments: Has Rear View Camera

2015 Volvo L90G

(Continued)

Serial #: VCE0L90GK0S617624

## Deficiency Review

DEFICIENCY REVIEW:			
	ITEM	QTY	PRICE
1.	Oil Filter Leaking		\$0.00
2.	Oil Fill Tube Leaking		\$0.00
3.	3 Front Work Lights Inop		\$0.00
4.	Left Rear Blinker Assembly Damaged		\$0.00
5.	Cutting Edge Worn - Not Turned		\$0.00
6.	Front Windshield Inop		\$0.00
7.	AC Inop - Not Cold		\$0.00
8.	1 Vent Louver Damaged		\$0.00
9.	Cab Steps Bent		\$0.00
10.	Right Steps Bent		\$0.00
11.	Battery Disconnect Box Lid Latch Missing		\$0.00
12.	Battery Disconnect Key Missing		\$0.00
13.	Coupler Has Lock Fault Code		\$0.00
14.	Radio Slot Blank Plate Missing		\$0.00
15.	Replace Tires Worn Past 50%		\$0.00
Total			\$0.00

# 2015 Volvo L90G

(Continued)

Serial #: VCE0L90GK0S617624





# 2015 Volvo L90G

(Continued)

Serial #: VCE0L90GK0S617624





# 2015 Volvo L90G

(Continued)

Serial #: VCE0L90GK0S617624





# 2015 Volvo L90G

(Continued)

Serial #: VCE0L90GK0S617624





# 2015 Volvo L90G

(Continued)

Serial #: VCE0L90GK0S617624





# 2015 Volvo L90G

(Continued)

Serial #: VCE0L90GK0S617624





# 2015 Volvo L90G

(Continued)

Serial #: VCE0L90GK0S617624






# 2015 Volvo L90G

(Continued)

Serial #: VCE0L90GK0S617624

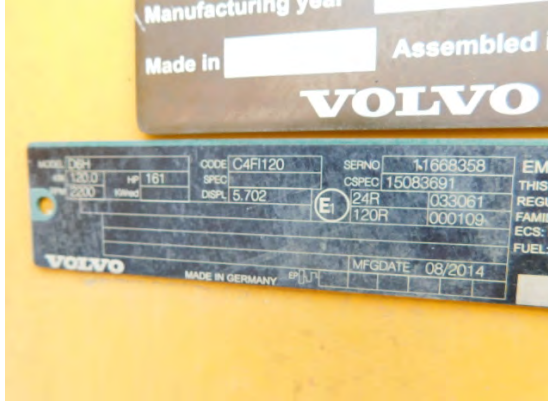



# 2015 Volvo L90G

(Continued)

Serial #: VCE0L90GK0S617624



# 2015 Volvo L90G

(Continued)

Serial #: VCE0L90GK0S617624

