

	Auxillary hydraulic lines	 Hand control pattern changer
Rudd Equipment	 Seat w/suspension, 	-
Nitro, WV	headrest and joystick	
304-755-7788	adjustment	
	SMU/Hours: 753	Start Run: Yes
	Overall: Good	• Insp Date: 5/14/2020









Serial #: 0526

General Appearance

Radiator Grille:	Good	Main Frame Welds:	Good	
Radiator Shroud:	Good	Car Body:	Good	
Engine Enclosure:	Good	Bumper:	Good	
Hood:	Good	Counterweight:	Good	
Stack:	Good	Cab:	Good	
Catwalk:	Good	Cab Door:	Good	
Fuel Tank:	Good	Steps or Ladder:	Good	
Crankcase Guard:	Good	Grab Irons/Handrails:	Good	
Precleaner bowl:	Good	Paint:	Good	
Battery Box:	Good	Oil Sample Taken:	No	



Serial #: 0526

Interior Section

Glass:	Good	Neutral Start Switch:	Good	
Mirrors:	Good	Fire Suppression System:	Not Available	
Seat Belt:	Good	Horn:	Good	
Back Up Alarm:	Good	ROPS:	Yes	
Fan Guards:	Good	FOPS:	Yes	
NOTES:				
OPERATOR AREA:				
Dash Console:	Good	Seat Cushion:	Good	
Meter:	Good	Arm Rests:	Good	
Gauges:	Good	Floor Boards/Mats:	Good	
Control Pattern Decals:	Good	EMS Panel:	Good	
Switches:	Good	Warnings:	Good	
Windshield Wipers:	Good	Door Latches:	Good	
Heater:	Good	Current Parts Manual:	Yes	
A/C:	Good	Current Safety Manual:	Yes	
Interior Lights:	Good	Current O&M Manual:	Yes	

(Continued)

Serial #: 0526

Power Systems

ENGINE:			
Engine Make Model:	Volvo D13J	Oil Pressure:	Normal
Engine S/N:	17481129	Smoke:	No
Engine Hours:	753	Smoke Color:	Not Applicable
Oil Leaks:	No	TurboCharger:	Good
Blow-by:	No	Fuel Injection System:	Good
Knocking:	No	Governor:	Good
Compression in Radiator:	No	Engine Supports:	Good
Water in Oil:	No	Air Cleaners:	Good
Fluid Level OK?:	Yes	+Last Scheduled Oil Sample:	-
Anit-Freeze Color:	Orange	- +Last Preventive Maintenance:	-
NOTES: COOLING SYSTEM:			
Radiator:	Good	Fan:	Good
Coolers:	Good	Fan Drive:	Good
Hoses:	Good	Belts:	Good
Water Pump:	Good	Pulleys:	Good
NOTES:	Good		6000
ELECTRICAL SYSTEM:			
Batteries:	Good	Wiring:	Good
Battery Cables:	Good	Pre-Heater:	Good
Starter:	Good	Lighting:	Good
Alternator:	Good		



Serial #: 0526

Power Systems - Continued

TRANSMISSION:			
Type:	Hydrostatic	Controls:	Good
Speeds:	Fair	Seals:	Good
Transmission Forward:	Good	Temp/Pressure Gauges:	Good
Transmission Reverse:	Good	Is the Transmission Noisy?:	No
Case:	Good		
NOTES:		· · · · ·	
FINAL DRIVE:			
Planataries:	Good	Housings:	Good
NOTES:			

(Continued)

Serial #: 0526

Hydraulics

Tank:	Good	Pumps:	Good	
Hydraulic Lines:	Good	Swing Gear:	Good	
Boom Cylinders:	Good	Pump Drive:	Good	
Stick Cylinder:	Good	Valves:	Good	
Bucket Cylinder:	Good			

Boom/stick/bucket

Boom type:	1 Piece	Bucket type:	General Purpose
Boom length:	21'	Bucket width:	5'
Boom condition:	Good	Bucket edge:	Good
Boom pins:	Good	Bucket sides:	Good
Boom/arm side clearance:	Good	Bucket bottom:	Good
Boom/arm alignment:	Good	Bucket linkage:	Good
Arm length:	12.79'	Bucket pins:	Good
Arm condition:	Good	Quick attach:	Good
Arm pins:	Good	Teeth:	Good
Bucket make:	Werk Brau	Cutting edge:	Good



Serial #: 0526

Attachments


Grapple:	No	Stump grinder:	No	
Compactor:	No	Slurry stirrer:	No	
Rotary cutter:	No	Ripper:	No	
Hammer:	No	Brush rake:	No	
Brush cutter:	No	Blade:	No	

(Continued)

Serial #: 0526

Undercarriage

TRACK RAIL	.S:				TRA	CK PADS:			
Brand:		Volvo		Pad Width:			75mm		
Pitch:		-			Pad Ty	/pe:		Single Grouser	
# Links:		Left: 48	Right: 4	.8	Grouser:		Left: 69mm		Right: 69mm
Туре:		Dry			Left S	calloped:		NO	
Rail:		Left: 123mm - 20% Right: 123mm - 20%		23mm -	Right	Scalloped:		NO	
Stretch:		-							
TRACK PINS	BUSHINGS:				IDLE				
Average Diameter: Turned:		Left: 70mm - 27% Right: 70mm - 27% NO		0mm - 27%	Idler Measurement:		Left	Right	
				Front Idler Rear Idler		24mm - 33% -	24mm - 33% -		
ROLLERS - (CARRIERS:					OCKET:			
# Of Rollers	1		2		Meası	ire of 3 Teeth		Left	Right
Left:	164mm - 5%		164mm - 5	%				Good	Good
Right:	164mm - 5%		164mm - 5	%					
ROLLERS -	воттом:								
# Of Rollers:	1	2	3	4		5	6	7	8
Left	-	-	-	189mm -	5%	189mm - 5%	-	-	189mm
Right	-	-	-	189mm -	5%	189mm - 5%	-	-	189mm
CONDITION:		Left	Right		MAI	NTENANCE:			
Track Frame:		Good	Good		+Last -	Track Inspection:		-	
NOTES:									



Serial #: 0526

Comments

COMMENTS: Creditor Comments: Public Comments:



Serial #: 0526

Reconditioning

DEFICIENCY REVIEW:				
ITEM	QTYPRICE			
2. dealer to determine if service is due	\$0.00			
Total	\$0.00			

(Continued)




(Continued)



(Continued)




(Continued)

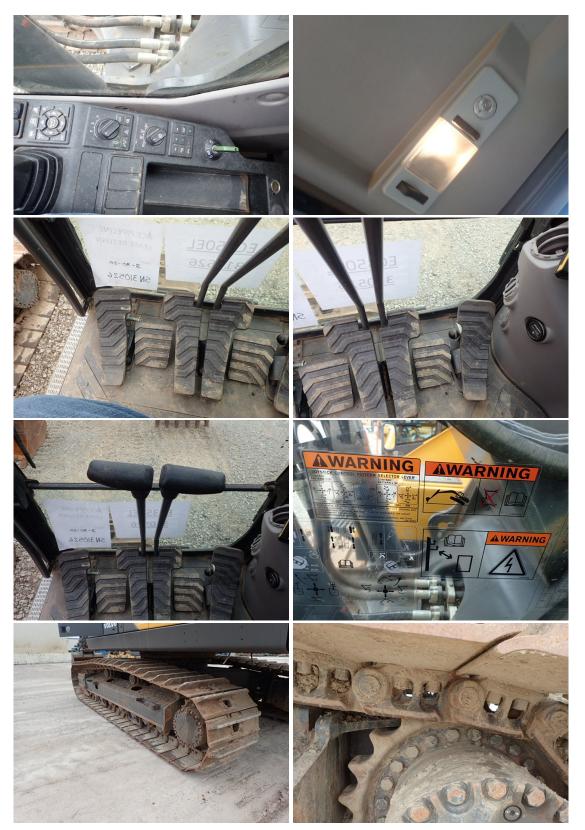

(Continued)




(Continued)

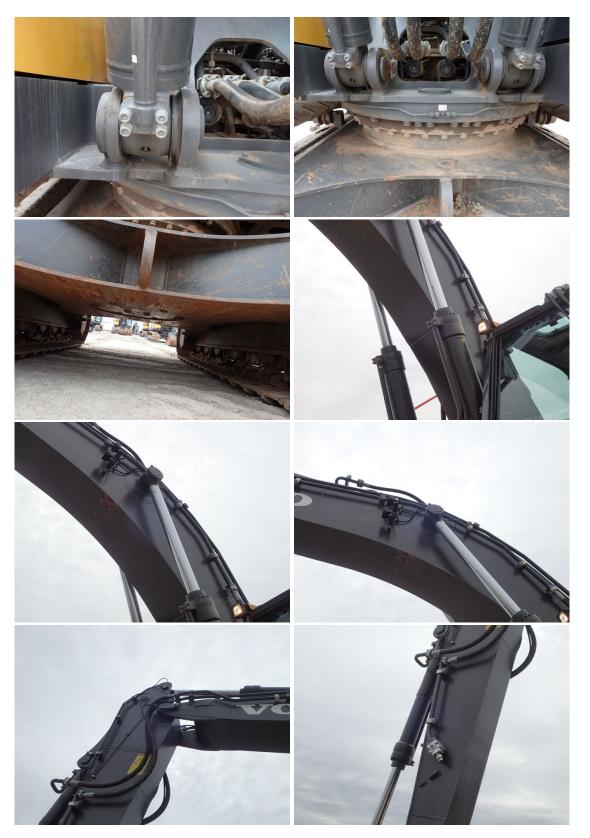

(Continued)




(Continued)

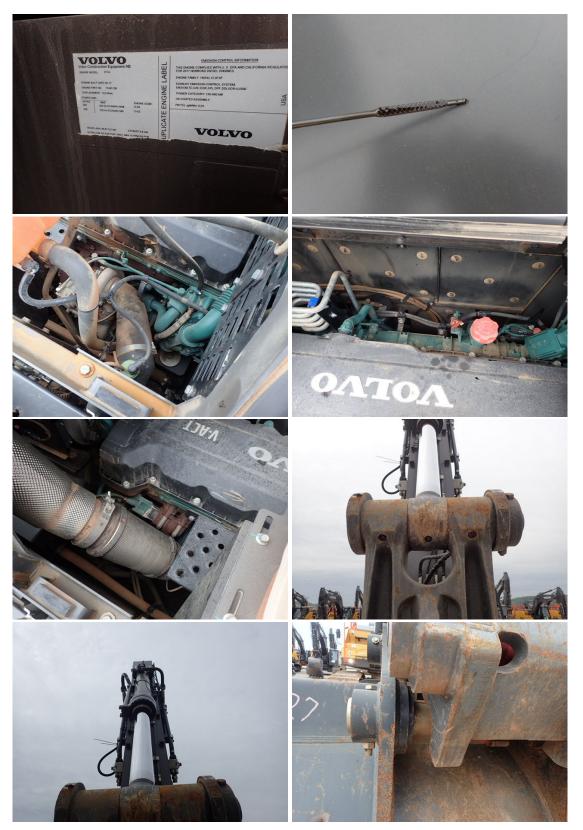

(Continued)



(Continued)

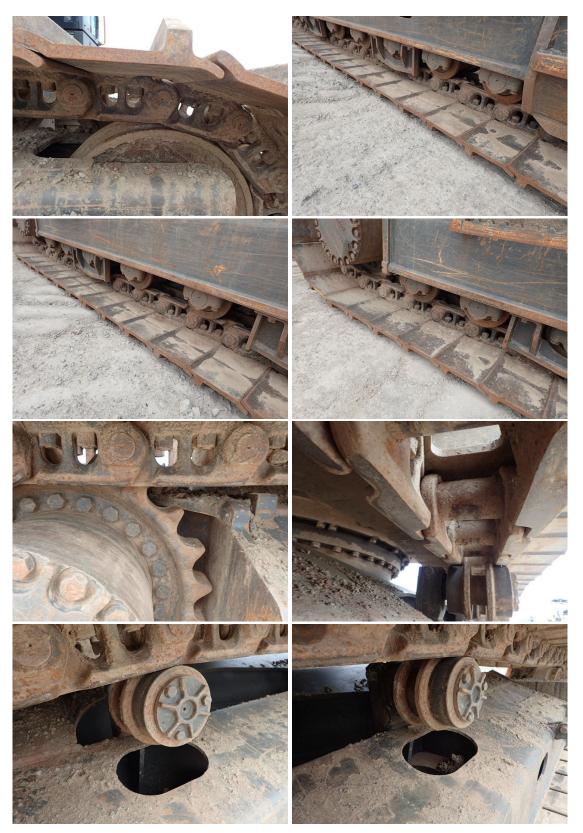

(Continued)



2018 Volvo EC350EL (Continued)



