

**Lessee: Monterey Mushrooms**  
**Contract: 502-0358599-064**

**Unit: 2016 Volvo L110H**

**UNIT # 1210**  
**Location: Romco Equipment,**  
**Carmine TX**



VIN	1210
LeaseInspector ID #	1210
Year	2016
Model	Volvo L110H
Location City	Carmine
Location State	TX
<b>General Specifications</b>	
New Hours	4902
Old Hours	4901

**Lessee: Monterey Mushrooms**  
**Contract: 502-0358599-064**

**Unit: 2016 Volvo L110H**

**UNIT # 1210**  
**Location: Romco Equipment,**  
**Carmine TX**

**Appraiser Comments:**

**Creditor Comments:**

**Public Comments:**

**Starts/Runs:** Yes

**Overall:** Fair

**Lessee: Monterey Mushrooms**  
**Contract: 502-0358599-064**

**Unit: 2016 Volvo L110H**



**UNIT # 1210**  
**Location: Romco Equipment,**  
**Carmin TX**

<b>ITEM</b>	<b>QTY PRICE</b>
1. Both Front Tire Past 50%- Not Replaced	\$0.00
2. Clean Machine Inside and Out, Engine and Undercarriage- Cleaned	\$0.00
3. Dealer to Assess Tire Cuts and Gouges- Cosmetic	\$0.00
4. Left Cab Step Damaged- Repaired	\$0.00
5. Left Rear Fender Step Damaged- Repaired	\$0.00
6. Left Rear Grab Iron Handrail Broken- Not Repaired	\$0.00
7. Left Mirror Missing- Replaced	\$0.00
8. Front Windshield Wiper Blade Missing- Replaced	\$0.00
9. A/C Warm Flashing AC Green Light- Not Repaired	\$0.00
10. Radiator Grille Holes, Dent- Replaced	\$0.00
11. Engine Enclosure Rear Broken- Replaced	\$0.00
12. Coolant Low- Replaced	\$0.00
13. Air Cleaner Dirty, Cover Clip Missing- Replaced	\$0.00
14. Front Panel Under Tilt Cylinder Damaged- Replaced	\$0.00
15. Seep Under Hydraulic Tank- Repaired	\$0.00
16. Right Front Tire Sidewall Gouged- Not Repaired	\$0.00
17. Left Rear Tire Cut- Not Repaired	\$0.00
18. Left Front Tire Sidewall Cut- Not Found	\$0.00
<b>Total</b>	<b>\$0.00</b>

Lessee: Monterey Mushrooms  
Contract: 502-0358599-064

Unit: 2016 Volvo L110H

UNIT # 1210  
Location: Romco Equipment,  
Carmine TX

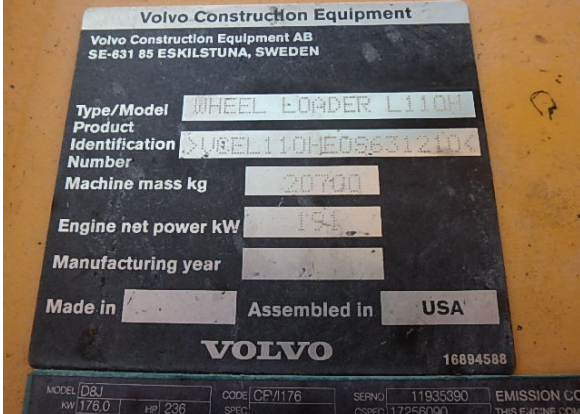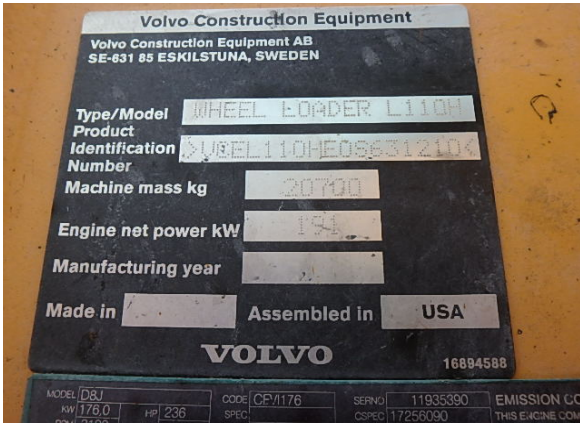




Lessee: Monterey Mushrooms  
Contract: 502-0358599-064

Unit: 2016 Volvo L110H

UNIT # 1210  
Location: Romco Equipment,  
Carmine TX

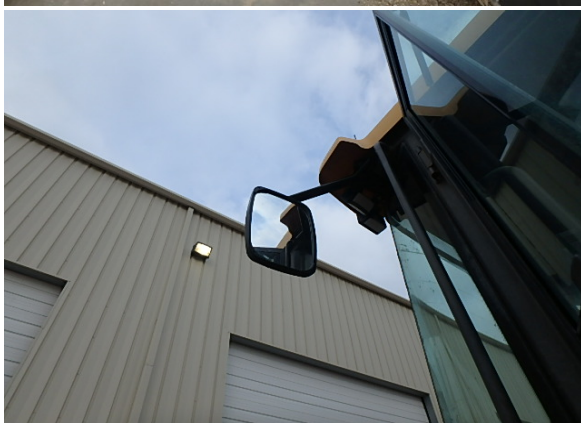




Lessee: Monterey Mushrooms  
Contract: 502-0358599-064

Unit: 2016 Volvo L110H

UNIT # 1210  
Location: Romco Equipment,  
Carmine TX

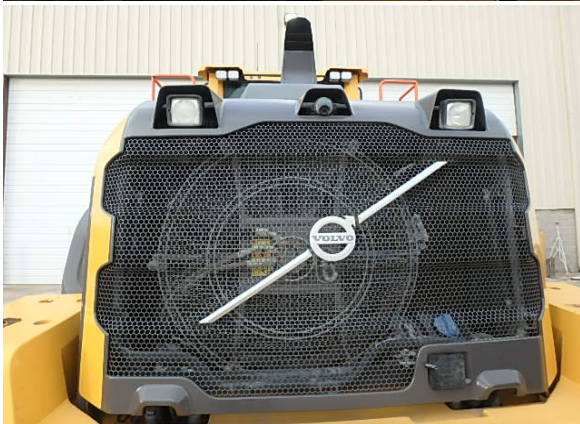

**Lessee: Monterey Mushrooms**  
**Contract: 502-0358599-064**

**Unit: 2016 Volvo L110H**

**UNIT # 1210**  
**Location: Romco Equipment,**  
**Carmine TX**

