

**Lessee: Batton Lake Development
INC
Contract: 502-7698494-001**

Unit: 2016 Volvo EC350EL

**UNIT # 0304
Location: Flagler Construction,
Jacksonville FL**



SPECIFICATIONS

VIN 0304
 LeaseInspector ID # 0304
 Year 2016
 Model Volvo EC350EL
 Location City Jacksonville
 Location State FL

General Specifications

New Hours 3178
 Old Hours 3168
 Track Rails
 Brand Volvo
 # of Link L 44, R 44
 Track Pins/Bushings L 63mm, R 63mm
 Track Pad Width 901mm
 Pad Type Triple
 Grouser Height L 33mm, R 33mm
 Scalloped L Yes, Right Yes
 Idlers
 Front 24mm
 Rear 24mm
 Carrier Rollers
 # of Rollers 2
 Left 158mm, 158mm
 Right 159mm, 158mm
 Bottom Rollers
 # of Rollers 8
 Left 180mm, 183mm, G, 185mm, 185mm, G, 184mm, 181mm
 Right 182mm, 185mm, G, 184mm, 185mm, G, 184mm, 181mm
 Track Frame Condition Good

**Lessee: Batton Lake Development
INC
Contract: 502-7698494-001**

Unit: 2016 Volvo EC350EL

**UNIT # 0304
Location: Flagler Construction,
Jacksonville FL**

**ADDITIONAL FEATURES OF THIS VEHICLE
COMMENTS**

Appraiser Comments:

Creditor Comments:

Track Were Packed with Mud During First Inspection- Was
Unable to Get All Undercarriage Measurements

Public Comments:

Track Were Packed with Mud During First Inspection- Was
Unable to Get All Undercarriage Measurements

Starts/Runs: Yes

Overall: Fair

**Lessee: Batton Lake Development
INC
Contract: 502-7698494-001**

Unit: 2016 Volvo EC350EL

**UNIT # 0304
Location: Flagler Construction,
Jacksonville FL**


DEFICIENCY REVIEW

ITEM	QTY	PRICE
1. Clean Machine- Done		\$0.00
2. Clean Machine Inside, Out, Engine, Undercarriage- Done		\$0.00
3. Fiberglass Cover for DPF Regen System Cracked by Stack- Not Repaired		\$0.00
4. Step by Toolbox Bent- Repaired		\$0.00
5. Driver Sprockets Worn- Not Replaced		\$0.00
6. Interior Light Inop- Repaired		\$0.00
7. ! Warning Light On- Repaired		\$0.00
8. Stack Dented- Replaced		\$0.00
9. Engine Oil Collection at Valve Cover Cormers- Replaced, Not Cleaned		\$0.00
10. Alternator Message Battery Not Charged- No Message		\$0.00
11. Boom Pins Movement- Not Repaired		\$0.00
12. Bucket Pins Worn- Not Repaired		\$0.00
Total		\$0.00

Lessee: **Batton Lake Development
INC**
Contract: **502-7698494-001**

Unit: **2016 Volvo EC350EL**

UNIT # **0304**
Location: **Flagler Construction,
Jacksonville FL**

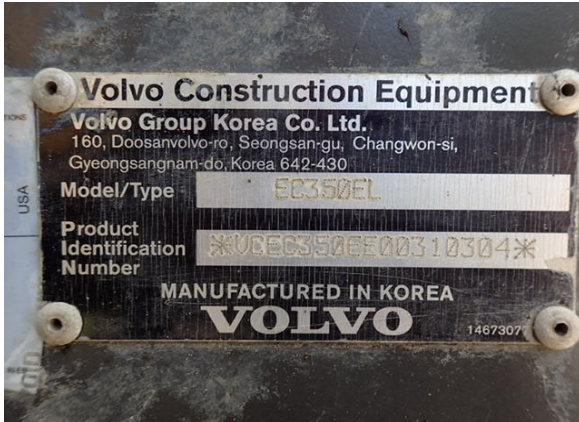

**Lessee: Batton Lake Development
INC
Contract: 502-7698494-001**

Unit: 2016 Volvo EC350EL

**UNIT # 0304
Location: Flagler Construction,
Jacksonville FL**



11/21/2019

LeaseInspector Off-Lease

**Lessee: Batton Lake Development
INC
Contract: 502-7698494-001**

Unit: 2016 Volvo EC350EL

**UNIT # 0304
Location: Flagler Construction,
Jacksonville FL**