

Lessee: Elmore Sand and Gravel Inc
Contract: 502-7508782-027

Unit: 2017 Volvo EC750EL

UNIT # 0069
Location: Elmore Sand & Gravel -
Spillway Rd, Elmore AL



VIN	0069
LeaseInspector ID #	0069
Year	2017
Model	Volvo EC750EL
Location City	Elmore
Location State	AL
General Specifications	
New Hours	4515
Old Hours	4518
Left Track Pins/Bushings	85mm
Right Track Pins/Bushings	85mm
Left Track Carrier Rollers	200mm
Right Track Carrier Rollers	200mm
Right Bottom Rollers	239mm

Lessee: Elmore Sand and Gravel Inc
Contract: 502-7508782-027

Unit: 2017 Volvo EC750EL

UNIT # 0069
Location: Elmore Sand & Gravel -
Spillway Rd, Elmore AL

Appraiser Comments:

Creditor Comments:

Public Comments:

Starts/Runs: Yes

Overall: Fair

Lessee: Elmore Sand and Gravel Inc
Contract: 502-7508782-027

Unit: 2017 Volvo EC750EL

UNIT # 0069
Location: Elmore Sand & Gravel -
Spillway Rd, Elmore AL

ITEM	QTY PRICE
1. Derate Mode Engage, SCR Fault	\$0.00
2. Cab Step and 2 Right Side Steps Bent- Repaired	\$0.00
3. Right Side and Cab Entry Grab Irons/Hand Rails Bent- Repaired	\$0.00
4. Paint Scratched/Chipped- Repaired	\$0.00
5. Lower Right House Panel has Holes and Catwalk Welded On-Repaired	\$0.00
6. Sun Shade Loose in Cab- Repaired	\$0.00
7. Top Rear Windshield Latch Broken- Replace	\$0.00
8. 2 Pedal Pads Missing- Replaced	\$0.00
9. Rear Camera Inop- Wires Cut Below Counterweight- Repaired	\$0.00
10. Hoses Under Boom Cut and Plugged- Repaired	\$0.00
11. Hydraulic Pump Access Door Strap Broken- Replaced	\$0.00
12. Lower Front Window Seal Cut- Replaced	\$0.00
13. Clean Machine Inside, Out, Engine, Undercarriage- Done	\$0.00
14. All 6 Carrier Rollers Past 50%- Replaced	\$0.00
15. Dealer to Determine is Service is Due- Not Due	\$0.00
16. Left Rear of Engine Seeping- Repaired	\$0.00
17. Air Cleaner Dirty- Replaced	\$0.00
18. Air Cleaner Cap O-Ring Seal Missing- Repaired	\$0.00
19. Engine has A Miss- Repaired	\$0.00
20. Right Boom Light Inop- Repaired	\$0.00
21. Right Side Bucket Cylinder Line Bent- Repaired	\$0.00
22. Hydraulic Fluid Level Low- Repaired	\$0.00
23. Bottom of Boom Gouged- Repaired	\$0.00
24. Bucket Retainer Pin Bolts Broken- Replaced	\$0.00
25. 1 Left Rear Track Frame Bolt Missing- Replaced	\$0.00
26. Right Track Gouged in Front of Sprocket- Repaired	\$0.00
27. Right 4,5,6 Bottom Rollers Damaged- Replaced	\$0.00
28. 1 Right Side Track Pin/Bushings Shattered- Replaced	\$0.00
29. 1 Left Side Track Pin/Bushings Cracked- Replaced	\$0.00
30. Both Windshield Pieces Replace with Plexiglass- Replaced	\$0.00
31. Right Mirror Broken- Replaced	\$0.00
32. Seat Belt Warning Constantly Sounds- Repaired	\$0.00
33. Windshield Wipers Inop- Repaired	\$0.00
34. A/C Warm- Repaired	\$0.00
35. Switch and Side of Seat Loose- Repaired	\$0.00
	\$0.00

36. Radiator and Hydraulic Pump Doors
Damaged- Replaced

37. Both Side Catwalk Bent- Repaired \$0.00

38. 2 Crankcase Guards Damaged-
Replaced \$0.00

Total \$0.00

Lessee: Elmore Sand and Gravel Inc
Contract: 502-7508782-027

Unit: 2017 Volvo EC750EL

UNIT # 0069
Location: Elmore Sand & Gravel -
Spillway Rd, Elmore AL



Lessee: Elmore Sand and Gravel Inc
Contract: 502-7508782-027

Unit: 2017 Volvo EC750EL

UNIT # 0069
Location: Elmore Sand & Gravel -
Spillway Rd, Elmore AL



Lessee: Elmore Sand and Gravel Inc
Contract: 502-7508782-027

Unit: 2017 Volvo EC750EL

UNIT # 0069
Location: Elmore Sand & Gravel -
Spillway Rd, Elmore AL



Lessee: Elmore Sand and Gravel Inc
Contract: 502-7508782-027

Unit: 2017 Volvo EC750EL

UNIT # 0069
Location: Elmore Sand & Gravel -
Spillway Rd, Elmore AL



Lessee: Elmore Sand and Gravel Inc
Contract: 502-7508782-027

Unit: 2017 Volvo EC750EL


UNIT # 0069
Location: Elmore Sand & Gravel -
Spillway Rd, Elmore AL



Lessee: Elmore Sand and Gravel Inc
Contract: 502-7508782-027

Unit: 2017 Volvo EC750EL


UNIT # 0069
Location: Elmore Sand & Gravel -
Spillway Rd, Elmore AL

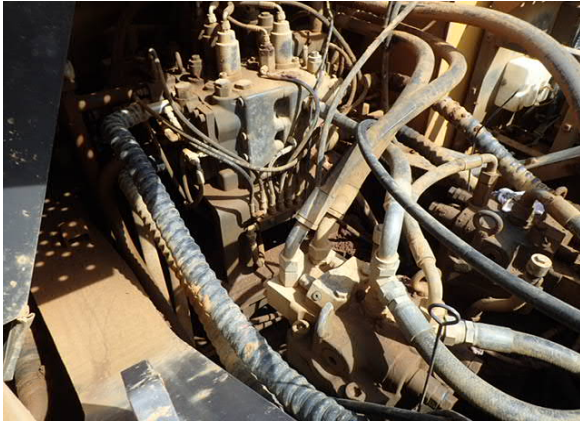

Lessee: Elmore Sand and Gravel Inc
Contract: 502-7508782-027

Unit: 2017 Volvo EC750EL

UNIT # 0069
Location: Elmore Sand & Gravel -
Spillway Rd, Elmore AL

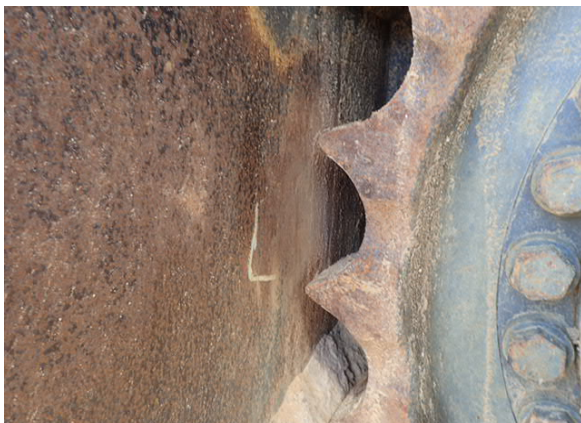

Lessee: Elmore Sand and Gravel Inc
Contract: 502-7508782-027

Unit: 2017 Volvo EC750EL

UNIT # 0069
Location: Elmore Sand & Gravel -
Spillway Rd, Elmore AL



Lessee: Elmore Sand and Gravel Inc
Contract: 502-7508782-027

Unit: 2017 Volvo EC750EL

UNIT # 0069
Location: Elmore Sand & Gravel -
Spillway Rd, Elmore AL



Lessee: Elmore Sand and Gravel Inc
Contract: 502-7508782-027

Unit: 2017 Volvo EC750EL


UNIT # 0069
Location: Elmore Sand & Gravel -
Spillway Rd, Elmore AL



Lessee: Elmore Sand and Gravel Inc
Contract: 502-7508782-027

Unit: 2017 Volvo EC750EL

UNIT # 0069
Location: Elmore Sand & Gravel -
Spillway Rd, Elmore AL

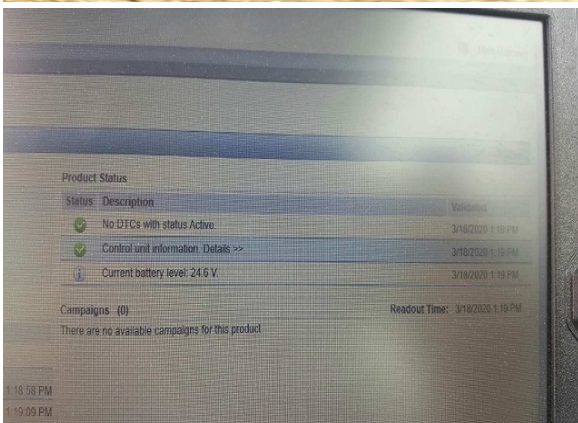

Lessee: Elmore Sand and Gravel Inc
Contract: 502-7508782-027

Unit: 2017 Volvo EC750EL

UNIT # 0069
Location: Elmore Sand & Gravel -
Spillway Rd, Elmore AL

